

**NOTIFICATION FORM FOR THE NOTIFICATION OF DANGEROUS PRODUCTS
TO THE AUTHORITIES BY PRODUCERS OR DISTRIBUTORS**

Section 1: Details of AUTHORITY(IES)/COMPANY(IES) receiving the notification form	
Authority/Contact name/Address/Telephone/Fax/E-mail/Website	Autoritatea Nationala pentru Protectia Consumatorilor / Directia Generala Supraveghere Piata / Serviciul Produse si Servicii Alimentare si Nealimentare/ Adresa: B-dul Aviatorilor nr.72 sector 1, Bucuresti / tel: 0213121275 / fax :0213143462, 0213110188/ Website: www.anpc.ro
Identification of the companies notified and their role in the marketing of the product	
Section 2: Details of PRODUCER/DISTRIBUTOR	
Producer or Producer 's representative/Distributor completing the form	SC MIZAR MOTORS SRL
Contact name, responsibility, Address/Telephone/Fax/Email/Website	Adriana Petz, STR. PRUNULUI NR 20, 430066 - BAIA MARE - MARAMURES, RO, Tel: +40.0262.430302 Fax: +40.0262.430303 Mail: office@mizarmotors.ro www.mizarmotors.ro
Section 3: Details of PRODUCTS involved	
Category. Brand or trademark. Model name(s) or Bar code/CN Tariff. Country of origin	TRUCK / ISUZU NQR90 / TURKEY
Description/Photograph	Attached Bulletin
Section 4: Details of HAZARD	
Description of the hazard and possible health/safety damages and conclusions of the risk estimation and evaluation carried out	The Passenger Seat Belt Warning Light does not activate despite the seat is occupied and the seat belt is not fastened.
Record of accident(s)	No accident (s)
Section 5: Details of corrective ACTIONS already taken	
Types/Scope/Duration of action(s) and precautions taken and identification of the company responsible	The operation to be carried out involves the restoring of the correct connection of the related electrical circuit.

**COMPANIES SHOULD COMPLETE AND SEND SECTION 6 IN CASE OF A
SERIOUS RISK OR WHEN THE PRODUCER/DISTRIBUTOR OPTS TO
SUBMIT THE NOTIFICATION ONLY TO THE AUTHORITY OF THE
MEMBER STATE IN WHICH THEY ARE ESTABLISHED**

Section 6: Details of other COMPANY(IES) in the supply chain which hold affected products	
List of Manufacturers/ Importers or Authorised representatives by Member State: Name/Address/ Tel/Fax/E-mail/Website.	SC MIZAR MOTORS SRL, STR. PRUNULUI NR 20, 430066 - BAI A MARE - MARAMURES, RO, Tel: +40.0262.430302 Fax: +40.0262.430303 www.mizarmotors.ro
List of Distributors/Retailers by Member State: Name/Address/ Tel/Fax/E-mail/Website	Dealer Network list attached
Number of products (serial numbers or date codes) held by producer/importer/ distributor/retailer/consumers by Member State	NNANAR6EH02000035 NNANAR6EH02000014



International Service Department
1-2-5, Takashima, Nishi-ku, Yokohama-shi,
Kanagawa, Japan
Tel: +81-45-299-9111

Recall Campaign

Reference Number: CL-959220-N212
14th February, 2023

Mr. Marco Vardabasso
Director
Service Department
MIDI Europe s. r. l

SUBJECT : NQR90 seatbelt warning light does not illuminate

Recall Campaign Category

Safety

Emission

Non-Compliance

Isuzu Motors Limited has decided to conduct the recall campaign for the captioned subject. You are kindly requested to cope with this matter regarding affected vehicles in accordance with laws of your country.

1. AFFECTED VEHICLES / ENGINE

For the affected vehicle in your territory, please see attached affected VIN list.

Model	<input checked="" type="checkbox"/> N <input type="checkbox"/> F <input type="checkbox"/> C&E <input type="checkbox"/> BUS
Model Year	2022
VIN Range	See attached VIN list

2. SERVICE INFORMATION

2-1. Condition

Isuzu found that seatbelt warning does not illuminated when the passenger sits in the seat in assembly line in Turkey.

This does not comply with UN regulation No.16.

Moreover, this failure should be potentially related to the safety because customer may able to not recognize not to fasten the seat belt.

2-2. Cause

Improper cab harness design by vehicle manufacturer.

2-3. Correction

Cab harness circuit modification.

3. LABOR HOURS (including administrative time allowance)

Model	Operation Code	Description of operation	Labor Hours
N-series	X6764	HARNESS REPAIR	1.0

4. PARTS INFORMATION

Model	Description	Parts Number	Q'ty/ Unit
N-series	Terminal	None	2

Necessary parts have been already sent from AIOS to MIDI.

5. BILLING

All cost of labor incurred for this recall will be borne by Isuzu Motors Limited. Please follow the usual procedure of campaign warranty claim. Claims can be submitted in normal manner following the procedure outlined in the SPPM. PDI claims and sublet repair are permitted for this repair operation. However, please note that towing, sublet repair, dealer materials and duplicate claims are not permitted.

Please use the Operation Code described in the 3. Labor Hours, and use "96" as trouble code.


Please feel free to contact us whenever you have any questions or anything to clarify for this recall campaign.

Attachments:

1. Affected VIN List

Working procedure manual already shared.

Sincerely yours,


Kazuto Koba

General Manager
International Service Department
Isuzu Motors Limited

SSBRO.051N.2023

To ISUZU Dealer
Att. Management
After-sales Manager

Cerea, 28/02/2023

SUBJECT: X6764 Recall Campaign; Q95 Seat Belt Warning Light harness modification

Dear Collaborator,

ISUZU always pays special attention to After Sales Service and to the quality of its products, in order to satisfy its Customers. For this reason, it was deemed necessary to intervene with a Recall Campaign on some ISUZU Q95. Due to an incorrect connection of the electric circuit, on these vehicles the Passenger Seat Belt Warning Light does not activate despite the seat is occupied and the seat belt is not fastened. The operation to be carried out involves the restoring of the correct connection of the related electrical circuit.



Picture 1



Picture 2

Picture 1. Not correct condition: the Seat Belt Warning Light remains OFF despite the seat is occupied and the seat belt is not fastened.

Picture 2. Correct condition (after repair): the Seat Belt Warning Light is ON when the seat is occupied and the seat belt is not fastened.

We inform you that the Customer of affected vehicles (with registration data input in MIDINET before 28/02/2023) will be informed via registered letter by MIDI Europe, in order to invite them to go to an ISUZU Authorized Workshop to perform the mentioned operation.

For all vehicles currently at stock at the Dealerships, repair work is required BEFORE the delivery of the vehicle to the Customer/final User.

MIDI Europe s.r.l.

VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236
SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

SERVICE INFORMATION

1. Affected Vehicles

ISUZU Q95 Euro VI OBD-E

2. Corrective Action

Input VIN in “Vehicle Info” section of MIDINET to confirm that a vehicle is affected.

Operations to carry out are described in “Procedure for Seat Belt Warning Light harness modification”.

3. Information on Spare Parts to order

Order the below mentioned spare parts in order to properly modify the harness.

P/N	Description	Q.ty
J501005205	Terminal for Q95 wiring restoring - Action X6764	1 per vehicle *

* The P/N includes 3 terminals, although the operation requires only 2. The additional terminal is supplied as a spare, if during the operation one of the terminals is damaged during crimping.

4. Information when submitting Warranty Claim

Input the Warranty Claim using the following Operation Code.

Operation Code	Description	Time (hrs.)
X6764	Q95 Seat Belt Warning Light harness modification	1

The Warranty Claim for labor and parts reimbursement must be input as “Warranty Claim for Recall Campaign”.

It is possible to input the warranty claim even if the vehicle has not yet been registered. Please note that towing and dealer material are not permitted.

Do not forget to check, in “Vehicle Info” section of MIDINET, if a vehicle is affected by this operation and other necessary operations/Service Campaigns (if so, carry out them at the same time). No Warranty Claims will be reimbursed on vehicles not affected by this Recall Campaign and on vehicles for which this Service Action has already been carried out.

We remain at your disposal for any clarification and we wish you our best regards

MIDI EUROPE SRL
 After sales dept

MIDI Europe s.r.l.

VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202


Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236
 SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.


Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

Procedure for Seat Belt Warning Light harness modification

Wiring Diagram before the modification (wrong circuit)

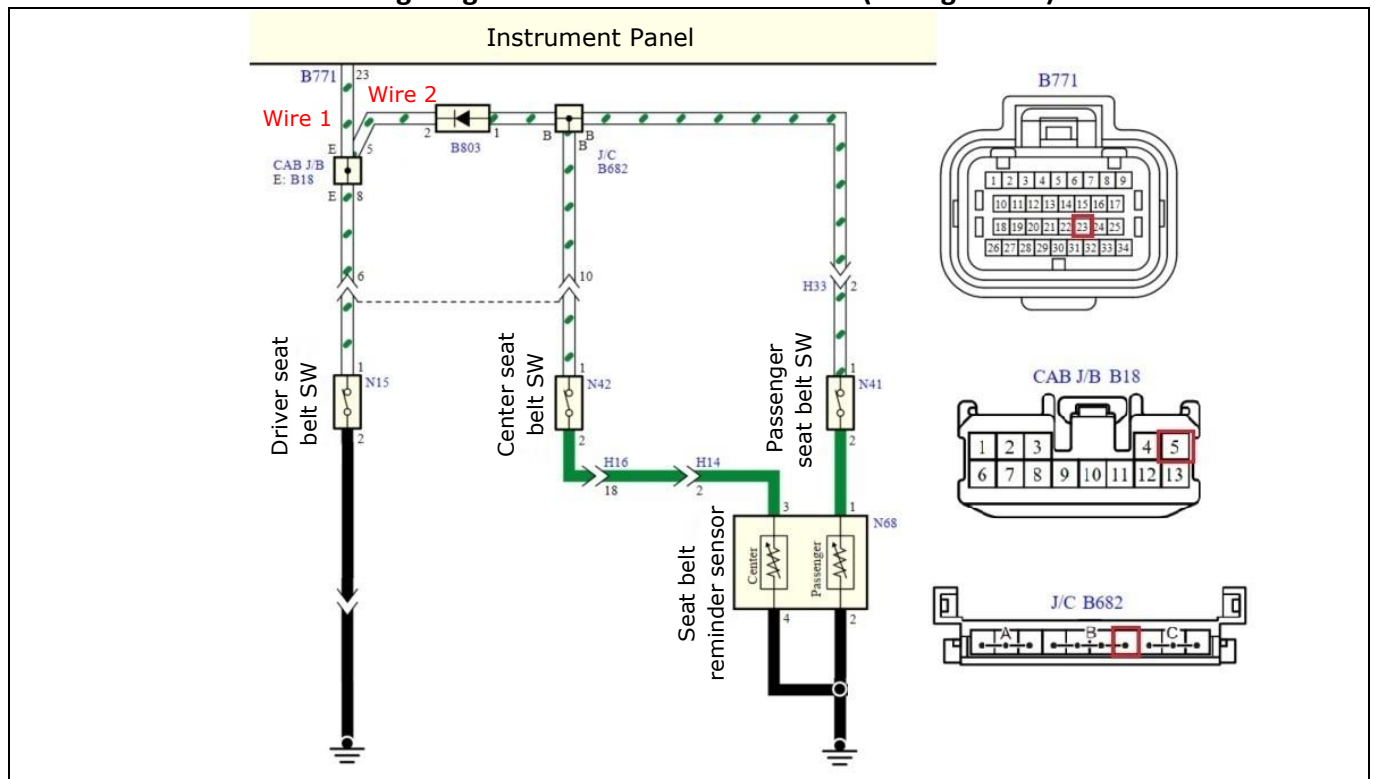

Wiring Diagram after the modification (correct circuit)

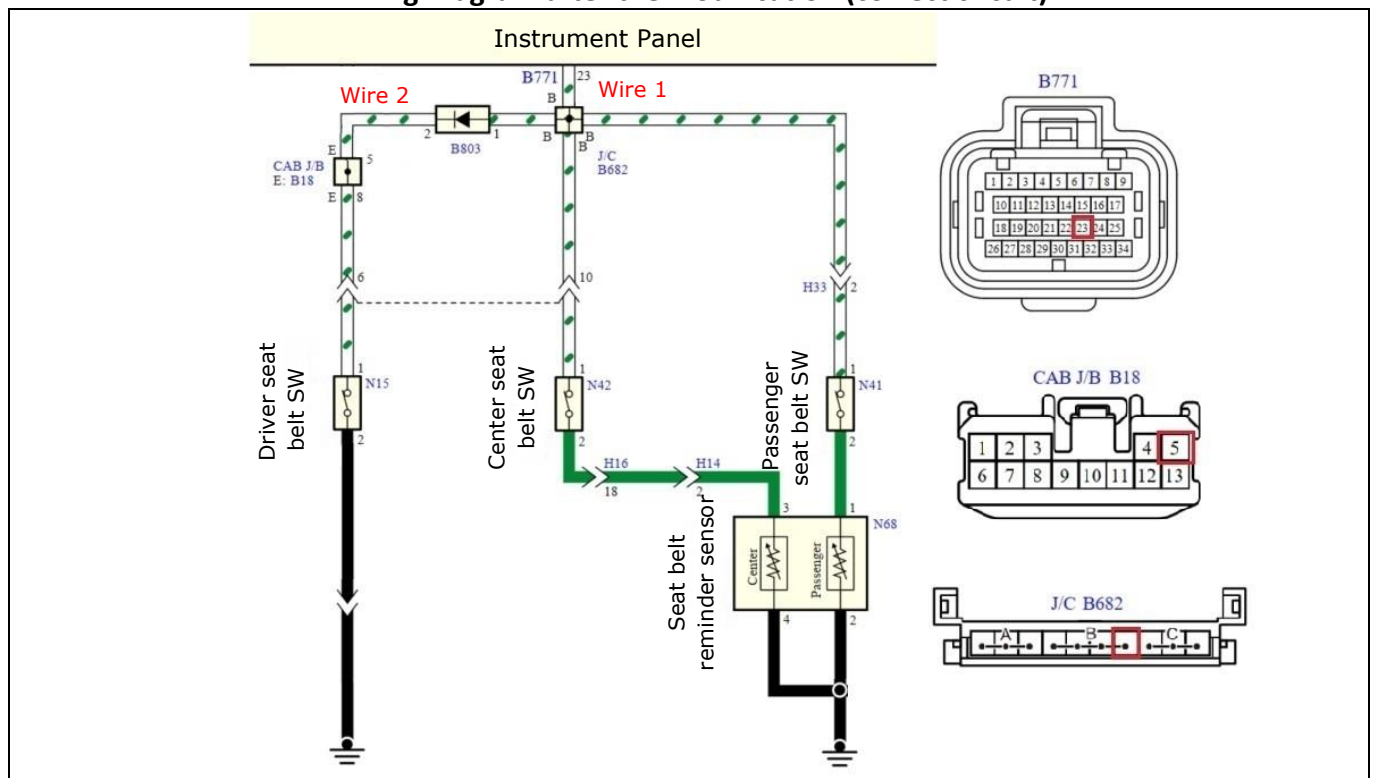

MIDI Europe s.r.l.


VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midi-europe.it – Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT091110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236
 SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

OPERATIONS WORKFLOW

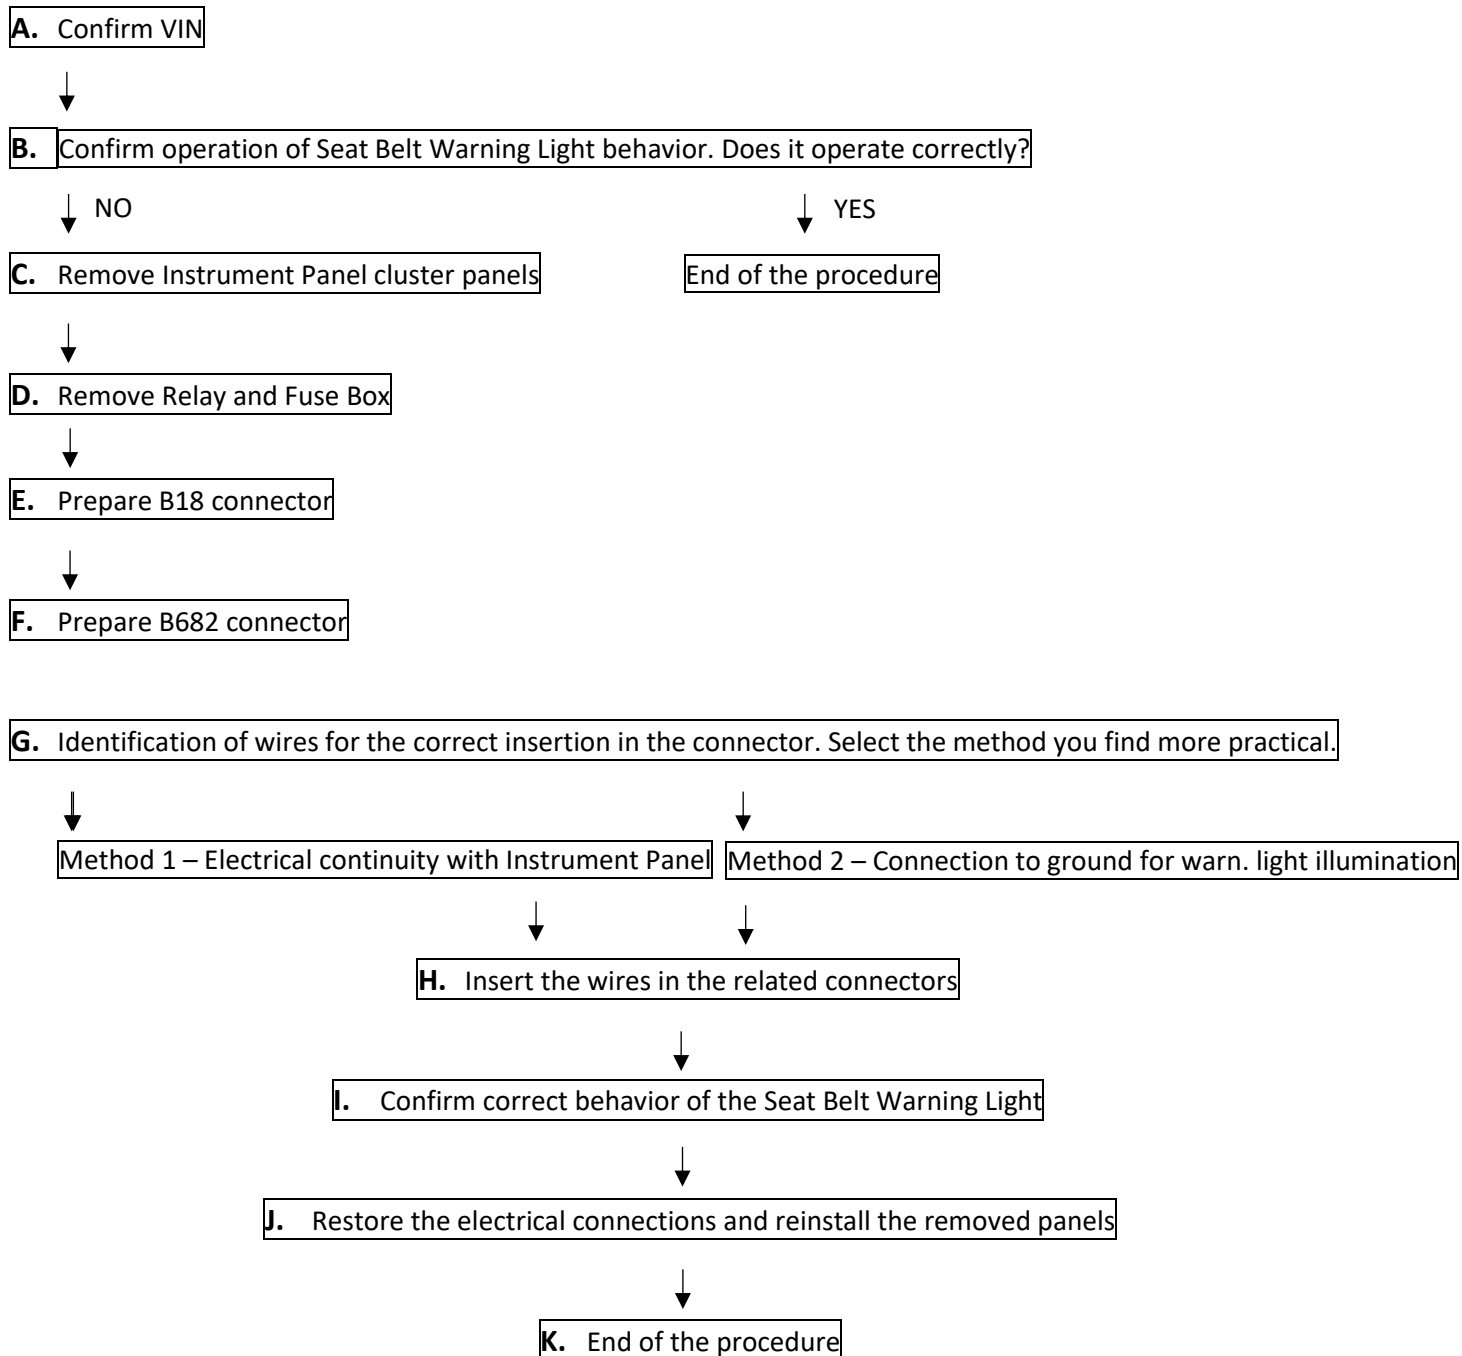

B. Confirm correct behavior of Seat Belt Warning Light



No Good condition



OK condition



Confirm that the Seat Belt Warning Light illuminates when one or both passenger seats are occupied (with seat belts not fastened).

If the Seat Belt Warning Light does not illuminate, proceed to step C.

Note

The test must be carried out with Driver seat belt fastened. Passengers seat belts must be not fastened.

MIDI Europe s.r.l.

VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236
SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

C. Instrument Panel Cluster panels removal**1) Removal of the upper cluster bezel**

Grab and pull the upper part of the bezel towards to detach it from the dashboard. Pay attention to the metal clip indicated in the picture. Use a screwdriver to push the metal tab out of its seat.

Note

It is not necessary to disconnect the connectors from the buttons/switches. This operation must be carried out to access the instrument panel and the lower panel of the dashboard in order to allow the removal.

MIDI Europe s.r.l.


VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236

SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

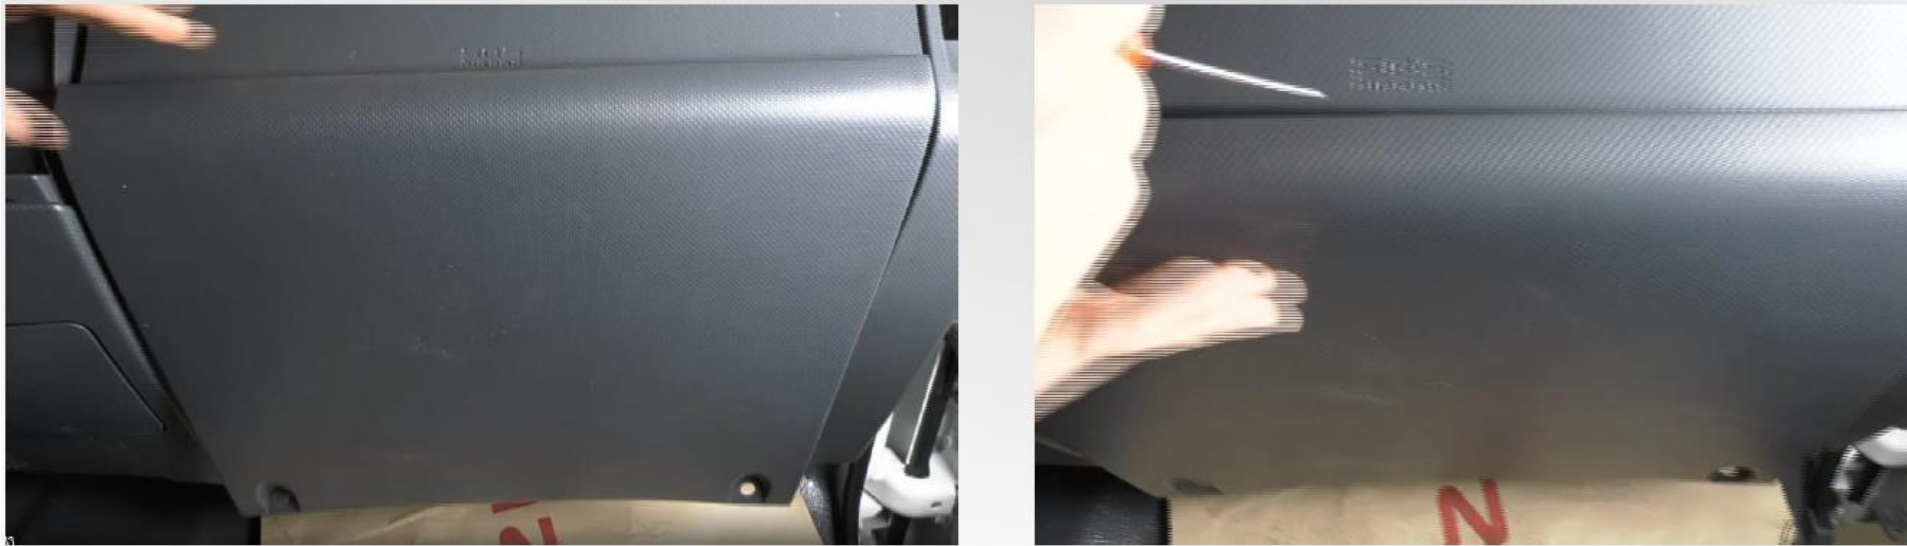

2) Removal of the dashboard lower side panel.

Remove the two fixing clips and remove the panel by pushing it upwards.

MIDI Europe s.r.l.


VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236

SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

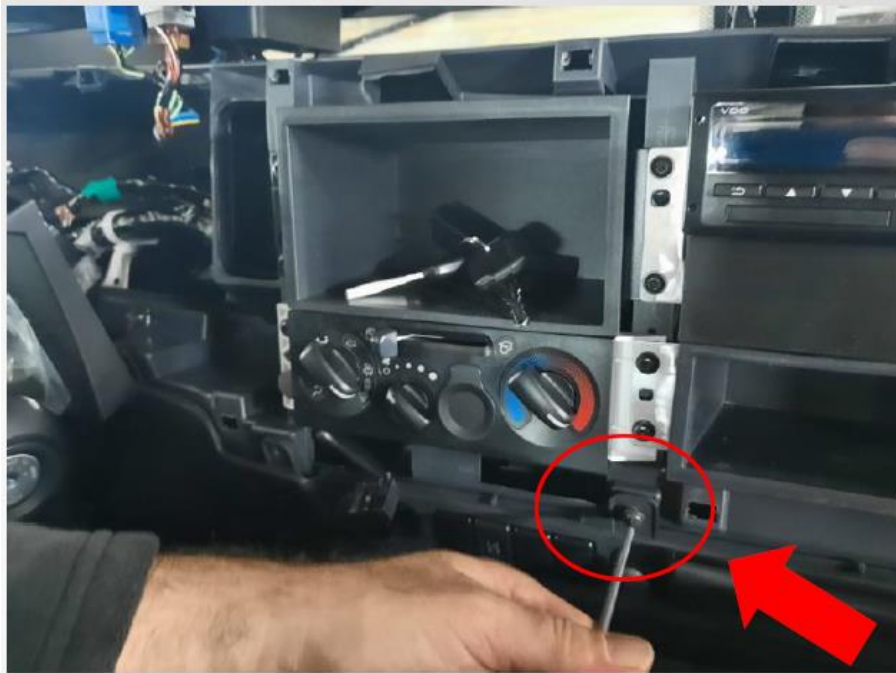

3) Removal of the dashboard central lower panel.
Remove the 4 T25 screws to remove the panel.

MIDI Europe s.r.l.

VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202


Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236

SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

D. Removal of Relay and Fuse box

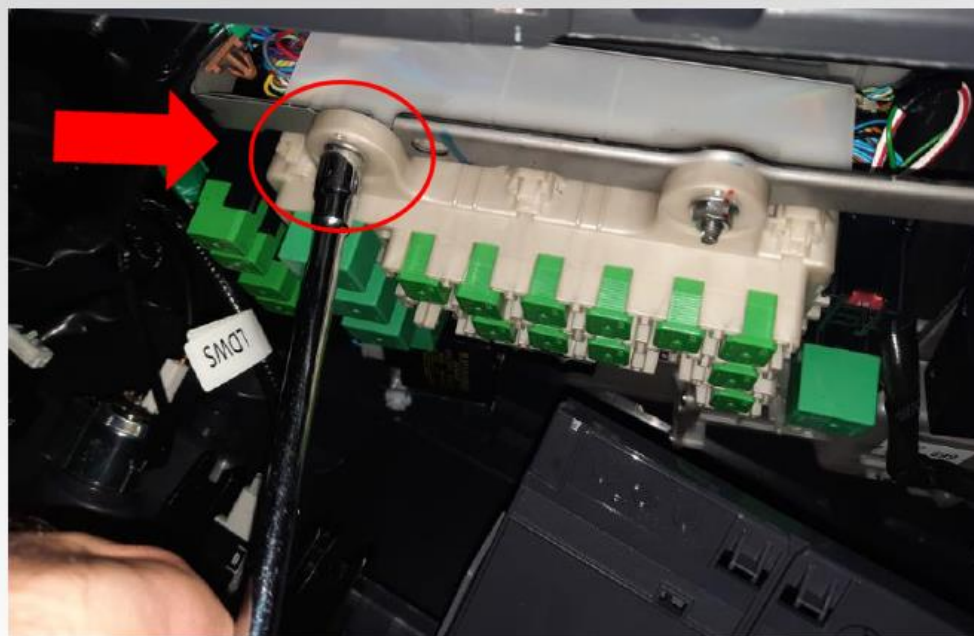

1) Remove the 2 nuts and remove the box from the stud bolts.

MIDI Europe s.r.l.



VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236

SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

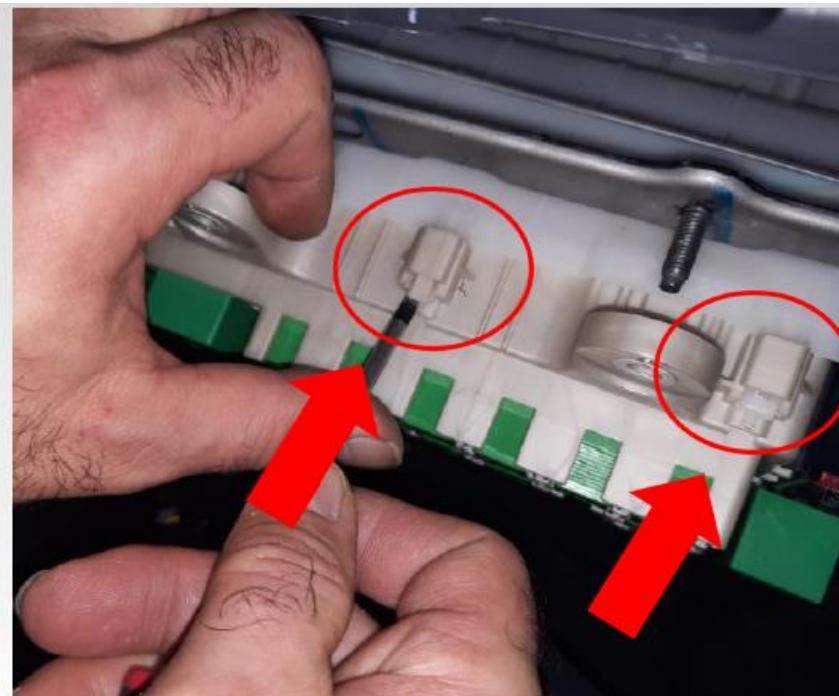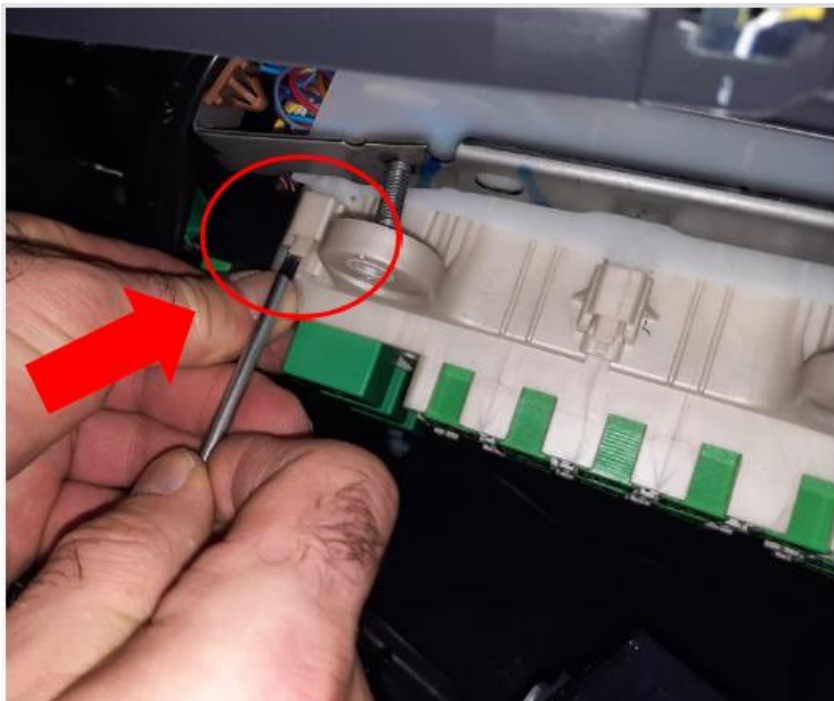

2) Release the 3 tabs in order to separate the rear cover from the Relay and Fuse box.

MIDI Europe s.r.l.


VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it – Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236
SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

E. Preparation of B18 connector

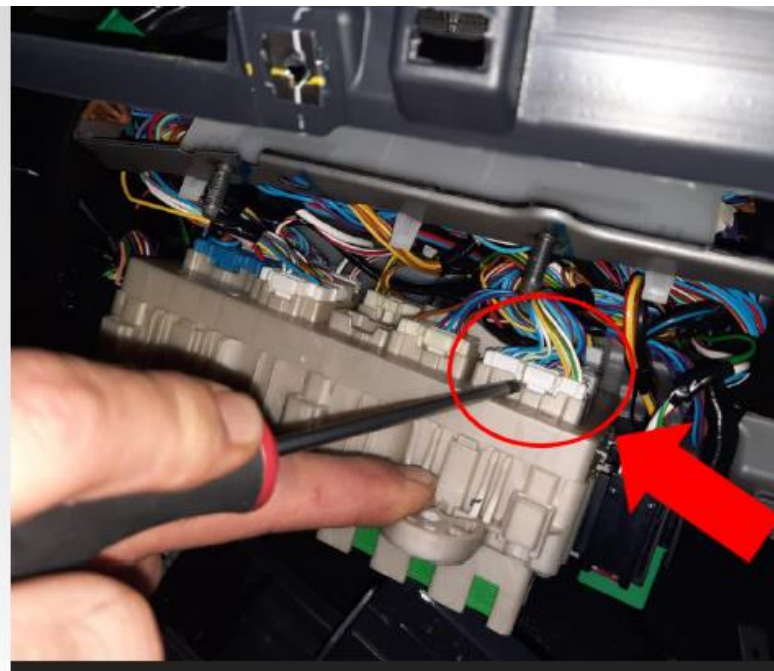

1) Identify and disconnect the B18 connector from Relay and Fuse box.

MIDI Europe s.r.l.


VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283




N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236

SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

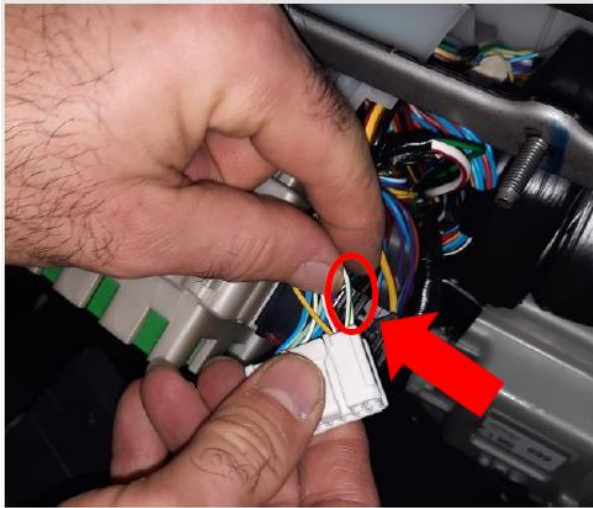

B18 Connector – Front view

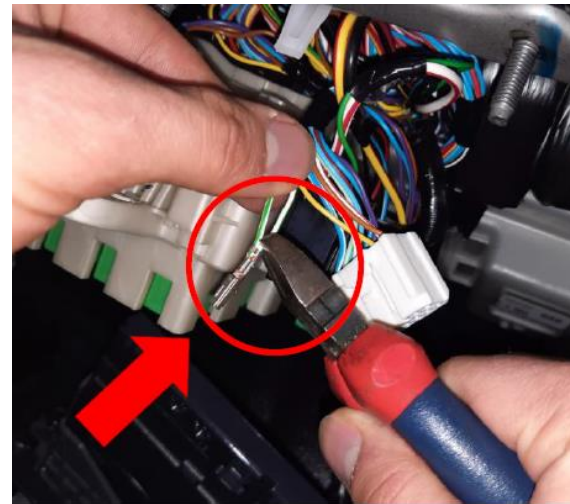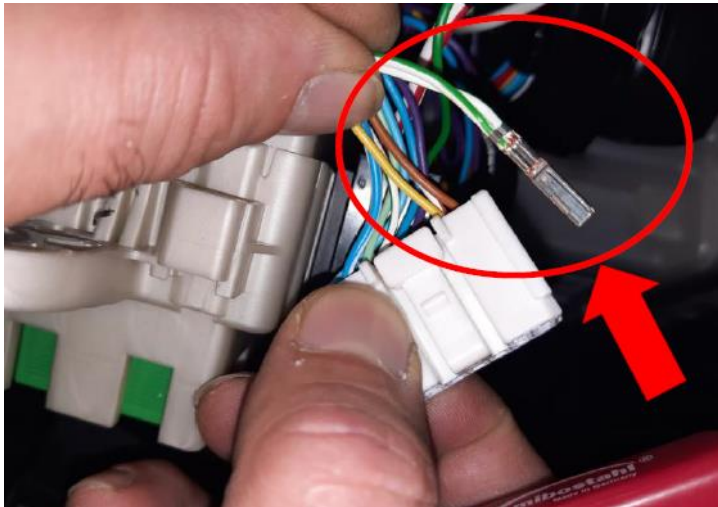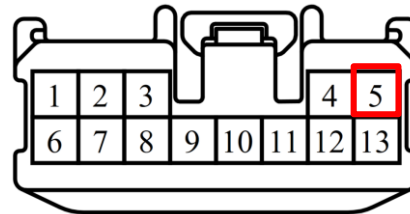

2) Remove the pair of white/green wires (pin 5) from B18 connector.


3) Cut both wires near the pin.

MIDI Europe s.r.l.

VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236
SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.
Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

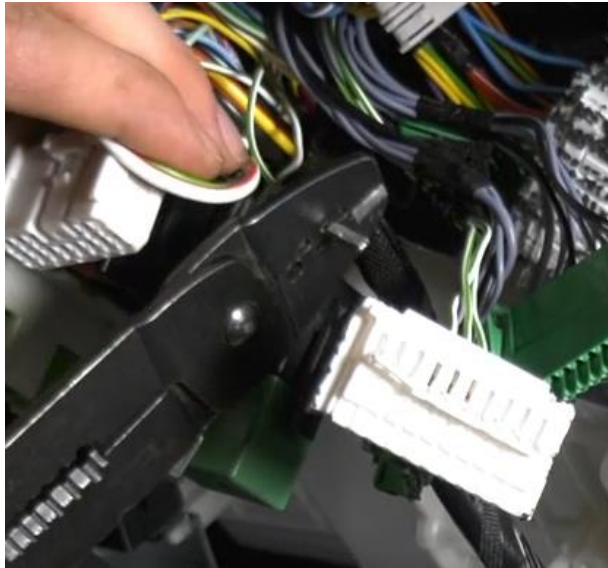


4) Crimp a new terminal (P/N J501005205) on each white/green wire.

MIDI Europe s.r.l.

F. Preparation of B682 connector



1) Identify the B682 junction connector. The junction connector is located, taped together other connectors, in the zone indicated by the arrow. The connector with 3 white/green wires is coupled with other connectors.

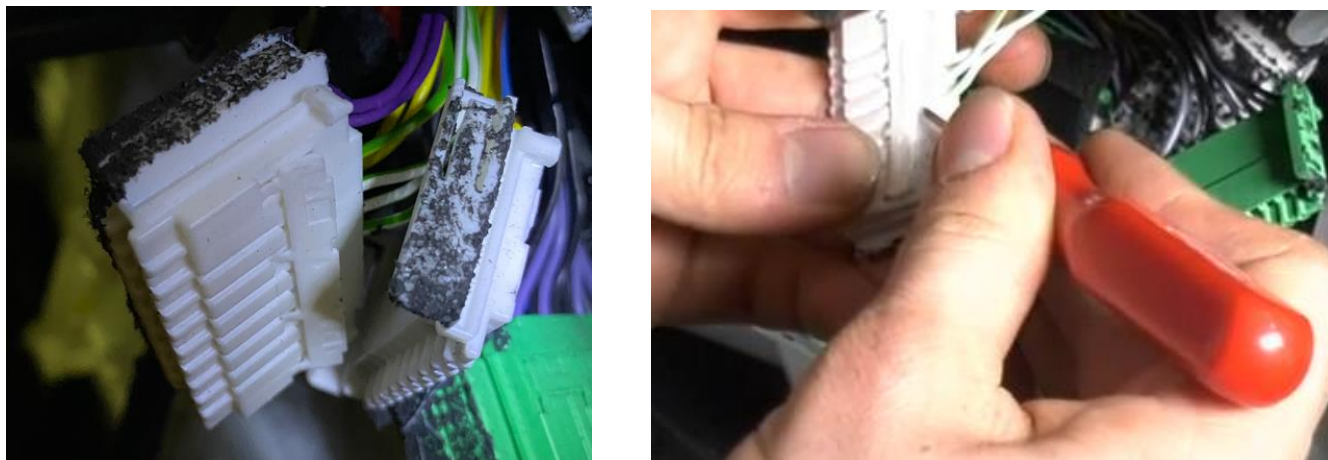

2) Remove the B682 junction connector from the other connectors by acting on the side tabs and by sliding it upwards.

3) Lift the connection lock tab in order to allow the insertion of a new terminal.

MIDI Europe s.r.l.


VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283


N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236
SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.
Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

G. Identification of wires for the correct insertion in the connector.

Method 1 - Electrical continuity with Instrument Panel

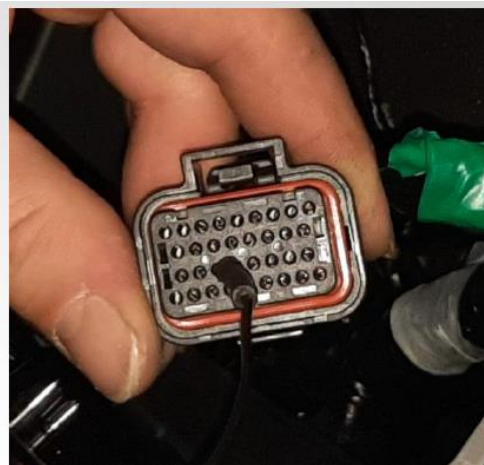

B771 Connector – Rear view
view PIN 23 white/green wire

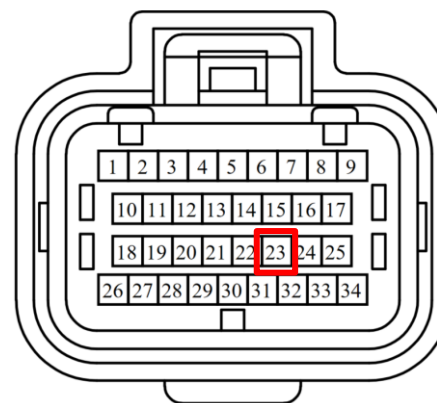

1) Remove the instrument panel and identify the B771 connector. Perform electrical continuity tests between connector B771 (PIN 23 – white/green wire) and both wires previously prepared.

Result:

Wire 1 = Wire in electrical continuity with Instrument Panel

Wire 2 = Wire not in electrical continuity with Instrument Panel

2) Reconnect connector B771 and reinstall the instrument cluster once the wires are identified.

MIDI Europe s.r.l.

VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202


Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236


SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

Method 2 - Connection to ground for warning light illumination

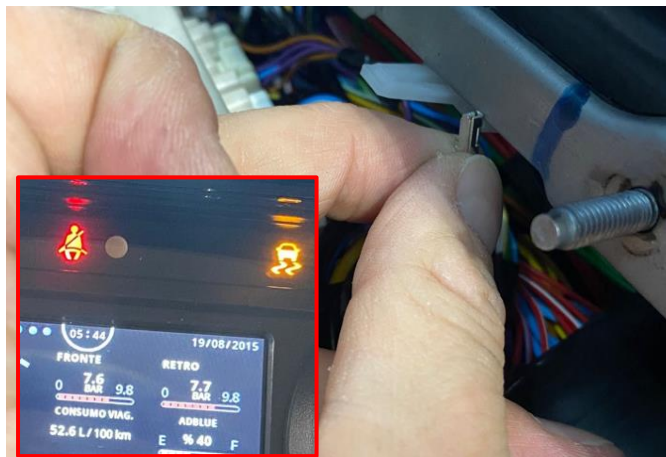

Warning light ON = Wire 1

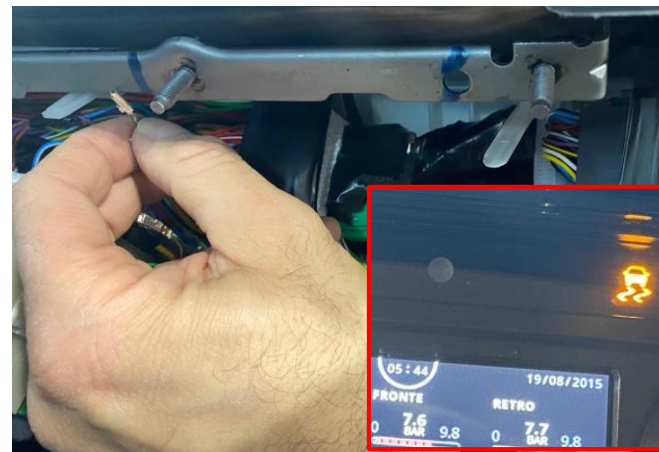

Warning light OFF = Wire 2

- 1) Reinsert connector B18 (with the white/green wires removed) in the relay and fuse box. This operation is recommended in order not to generate error codes after switching ON the ignition.
- 2) Switch ON the ignition.
- 3) Touch each terminal of the two previously prepared white/green wires to a ground point on the vehicle. In the example photos the Relay and Fuse box support plate is touched.

Result:

Wire 1 = Wire that turns ON the Seat Belt Warning Light in the Instrument Panel when it touches the ground point.

Wire 2 = Wire that does not turn ON the Seat Belt Warning Light in the Instrument Panel when it touches the ground point.

- 4) Once the wires have been identified, turn OFF the ignition and disconnect the B18 connector from Relay and Fuse box.

MIDI Europe s.r.l.



VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it – Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236
 SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

H. Insert the wires in the related connectors

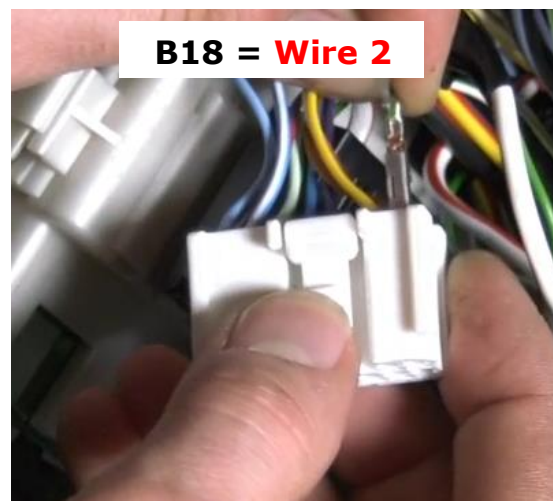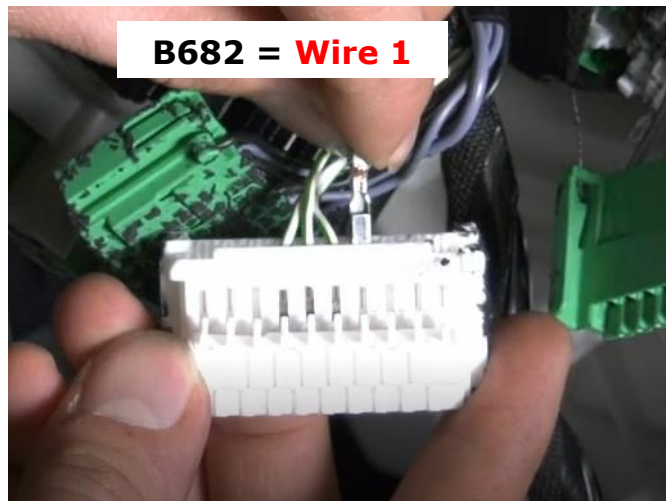

- 1) Insert Wire 1 into B682 junction connector (for the insertion position of the wire, refer to the picture “Wiring Diagram after the modification (correct circuit)” at page 3).
- 2) Insert Wire 2 into B18 junction connector (for the insertion position of the wire, refer to the picture “Wiring Diagram after the modification (correct circuit)” at page 3).

MIDI Europe s.r.l.

VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236

SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013

I. Confirm correct behavior of the Seat Belt Warning Light



OK condition



Confirm that the Seat Belt Warning Light illuminates when one or both passenger seats are occupied (with seat belts not fastened).
The Seat Belt Warning Light must turn OFF right after the seat belt of the occupied seat is fastened.

Note

The test must be carried out with Driver seat belt fastened. Passengers seat belts must be not fastened.

MIDI Europe s.r.l.

VIA CROSARON, s.n. – 37053 CEREVA VR – www.isuzu.it – info@midieurope.it - Tel. 0442 328.212 – Fax 0442 328.202

Iscritta al Reg. Impr. di VERONA C.F. e n. Iscr. 02560040236 Iscritta al R.E.A. di VERONA al n. 246283

N. Iscr. Registro Nazionale ex art. 14 D.Lgs 188/08 – IT09110P00001953 Capitale Sociale Euro 16.800.000,00 i. v. P.IVA n. 02560040236
SOCIETÀ SOGGETTA ALL'ATTIVITÀ DI COORDINAMENTO E CONTROLLO DA PARTE DELLA SOCIETÀ: MIDI PARTECIPAZIONI S.P.A.

Certificati acquisiti : UNI EN ISO 9001:2015, UNI EN ISO 14001:2015, UNI ISO 45001:2018, UNI CEI ISO/IEC 27001:2013



DEALER NAME	PHONE NR.	ADDRESS	MODEL
TH TRUCKS S.R.L	0040 372200500	CARTIERUL DE VEST DN 7, KM 553+700 M, JUD. ARAL - 317235 - ARAD	N N75
TH TRUCKS S.R.L	0040 234206091	STR. PRINCIPALA NR. 1232, COMUNA NICOLAE BALCESCU, JUD. BACAU - 607355 - BACAU	N N75
TH TRUCKS S.R.L	0040 372200700	CALEA FELDIOAREI NR. 26, JUD. BRASOV - 500471 - BRASOV	N N75
TH TRUCKS S.R.L	0040 372200066	STR. PRINCIPALA, NR 1333, COM. GILAU, SAT GILAU, JUDET CLUJ - 407310 - GILAU	N N75
TH TRUCKS S.R.L	0040 372200200	STR. CLUJULUI NR. 7, COMUNA APAHIDA, SAT SÂNNICOARA, JUD. CLUJ - 407042 - CLUJ	N N75
TH TRUCKS S.R.L	0040 372200800	STR. BABA NOVAC NR. 999, JUD. CONSTANTA - 900366 - CONSTANTA	N N75
TH TRUCKS S.R.L	0040 372200400	STR. CRÂNGULUI NR. 2, COMUNA CÂRCEA, JUD. DOLJ - 207206 - DOLJ	N N75
TH TRUCKS S.R.L	0040 213172555	STR. SOS. DE CENTURA NR. 7-9, COMUNA CHIAJNA, SAT CHIAJNA, JUD. ILFOV - 077040 - ILFOV	N N75
TH TRUCKS S.R.L	0040 372200066	STR. AUREL VLAICU NR. 77, JUD. IASI - 700381 - IASI	N N75
S.C. ALCOR MOTORS SRL	0040 744148142	LOC. VISEU DE JOS, STR. PRINCIPALA NR 153 - 437390 - MARAMURES	N N75